



NOTES:

1. See Detail ET 501-1 for full depth patching welded wire reinforcing .
2. See Detail ET 501-2 for full depth patching joint details and information.
3. If reinforcement is present within the partial-depth patch area and the bond is destroyed, remove adjacent concrete an additional 3/4 inch. If reinforcement is damaged, remove and replace in kind. Submit reinforcement replacement plan for approval.

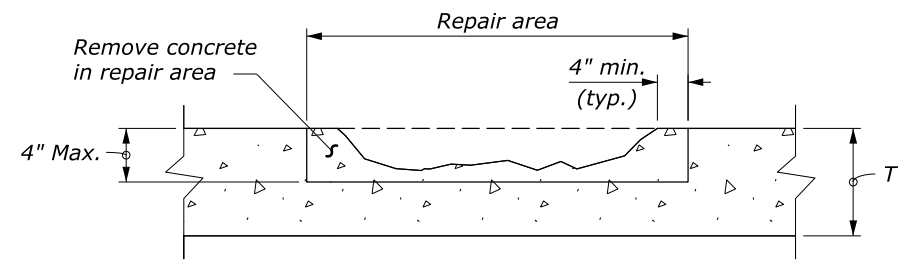


PLAIN CONCRETE PAVEMENT

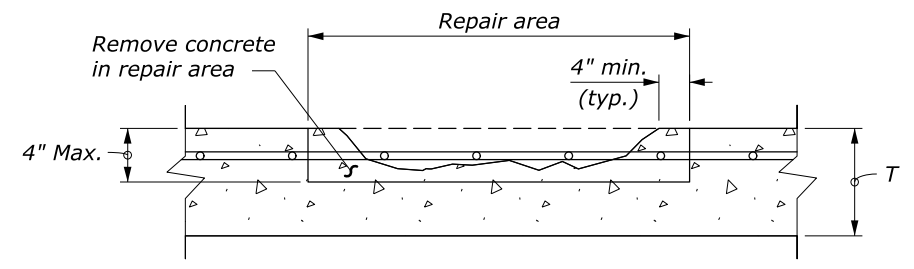


REINFORCED CONCRETE PAVEMENT


PARTIAL-DEPTH PATCHING

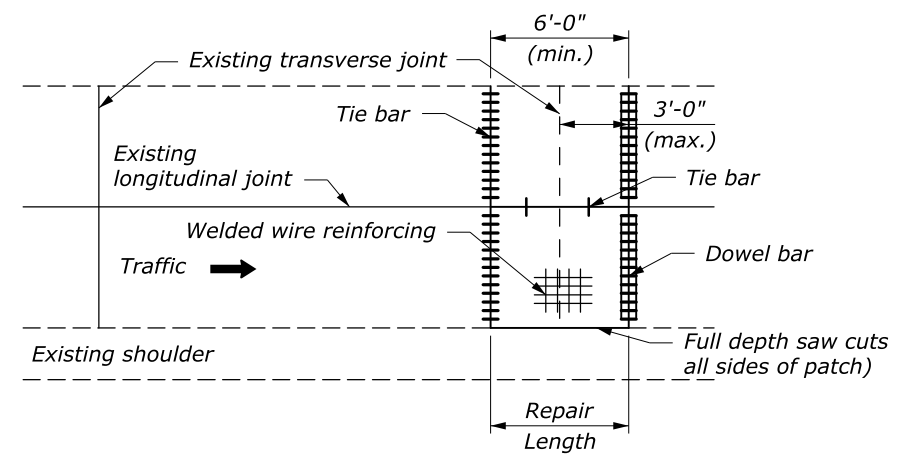


METHOD A

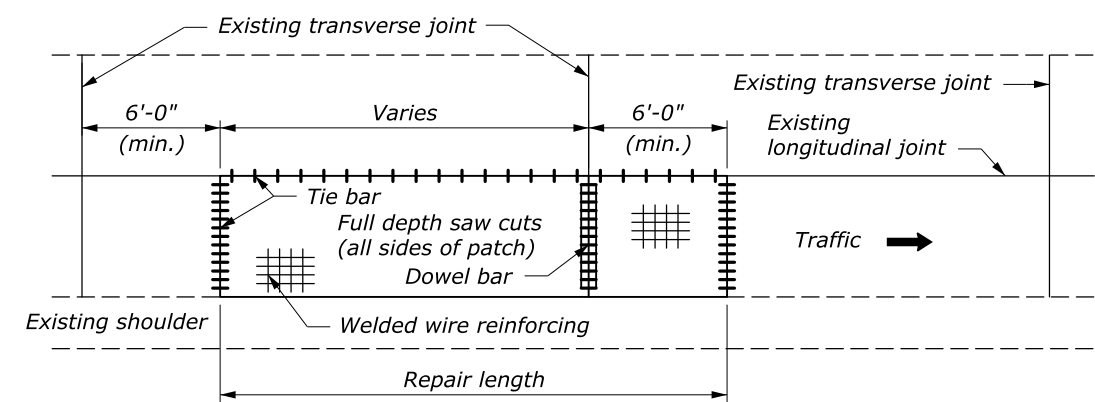

METHOD B

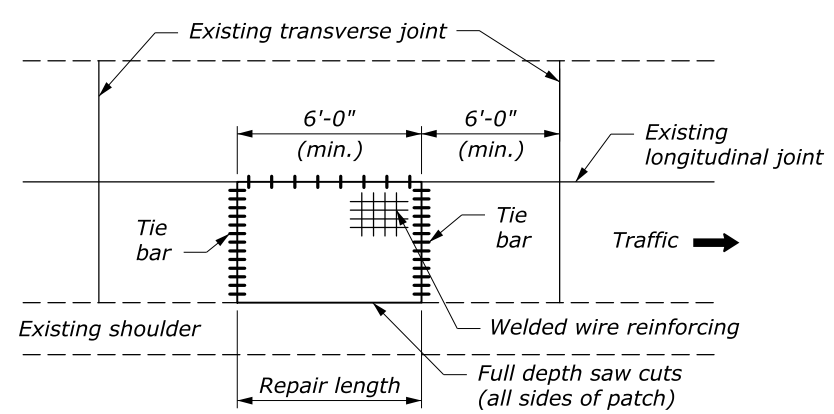

METHOD C

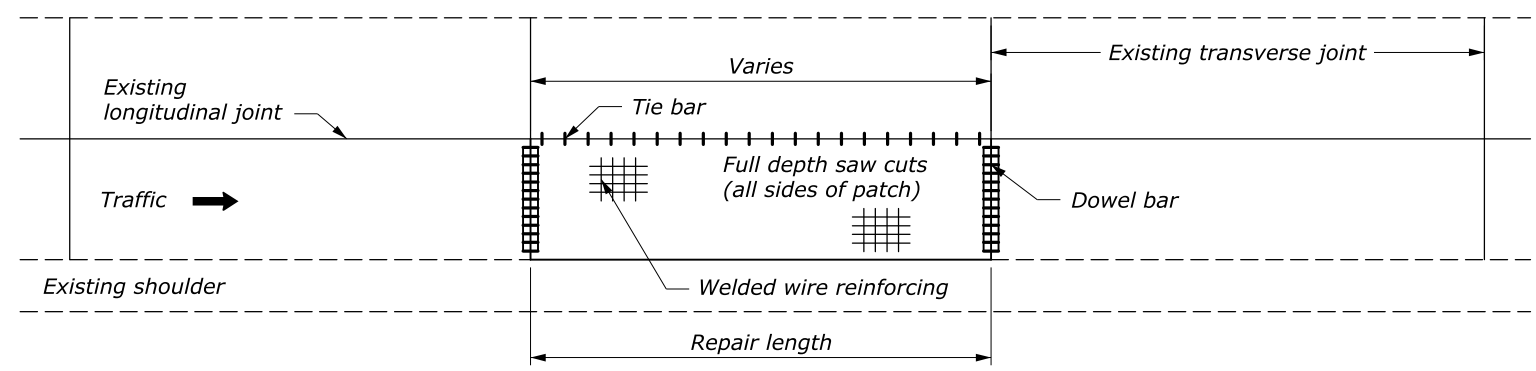

METHOD D

FULL DEPTH PATCHING LAYOUTS

| | |
|--|------------------------|
| U.S. DEPARTMENT OF TRANSPORTATION FEDERAL HIGHWAY ADMINISTRATION OFFICE OF FEDERAL LANDS HIGHWAY | |
| EFLHD DETAIL | |
| CONCRETE PAVEMENT RESTORATION | |
| NO SCALE | REVISID: 8/2016 9/2020 |
| | DETAIL ET 502-1 |

M:\PROJECTS\COLLABORATION\Ouhssayne_02172021_Details_Work\st50201_EFL_TEMP.dgn [Sheet] 17 February 2021 3:17 PM