



NOTES:

1. See Detail ET 501-1 for full depth patching welded wire reinforcing.
2. See Detail ET 501-2 for full depth patching joint details and information.
3. If reinforcement is present within the partial-depth patch area and the bond is destroyed, remove adjacent concrete an additional 3/4 inch. If reinforcement is damaged, remove and replace in kind. Submit reinforcement replacement plan for approval.

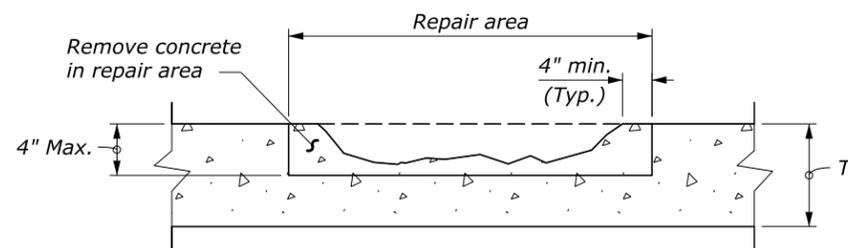


PLAIN CONCRETE PAVEMENT

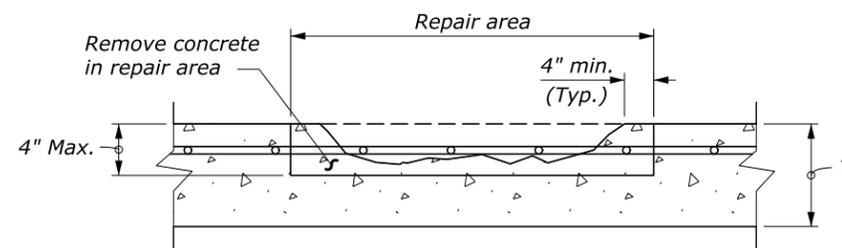


REINFORCED CONCRETE PAVEMENT


PARTIAL-DEPTH PATCHING

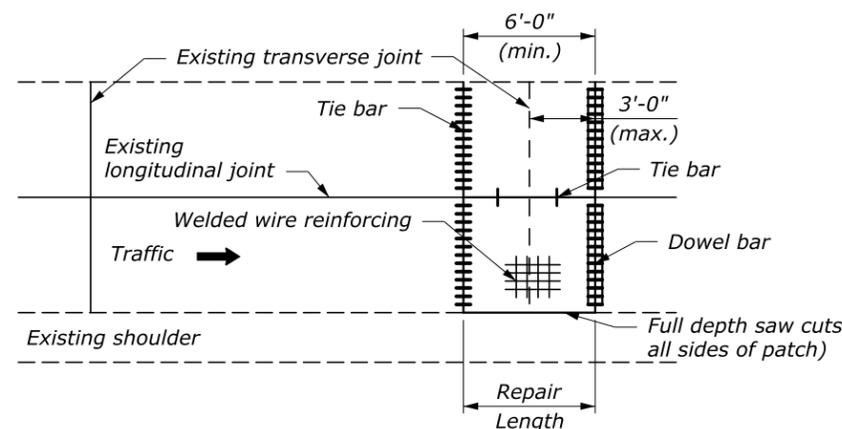


METHOD A

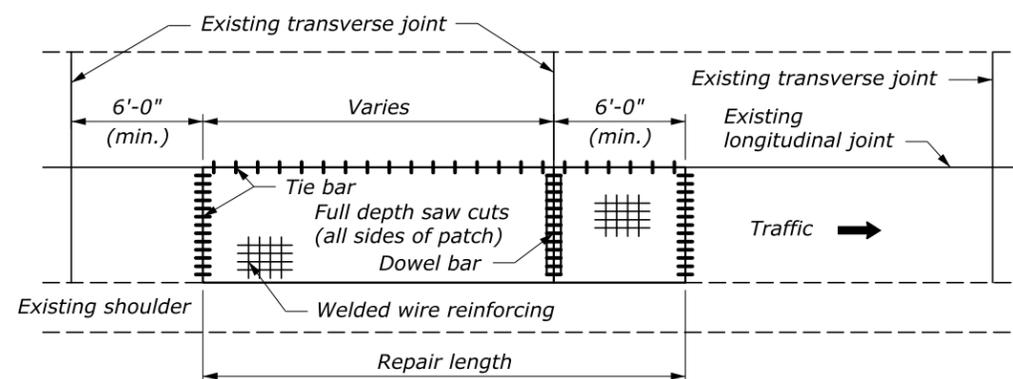

METHOD B

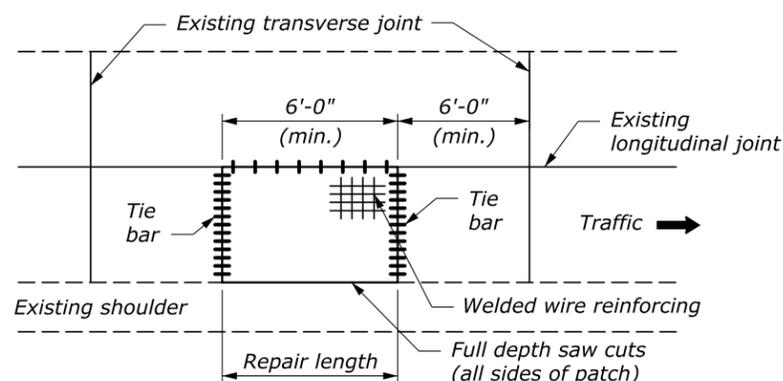

METHOD C

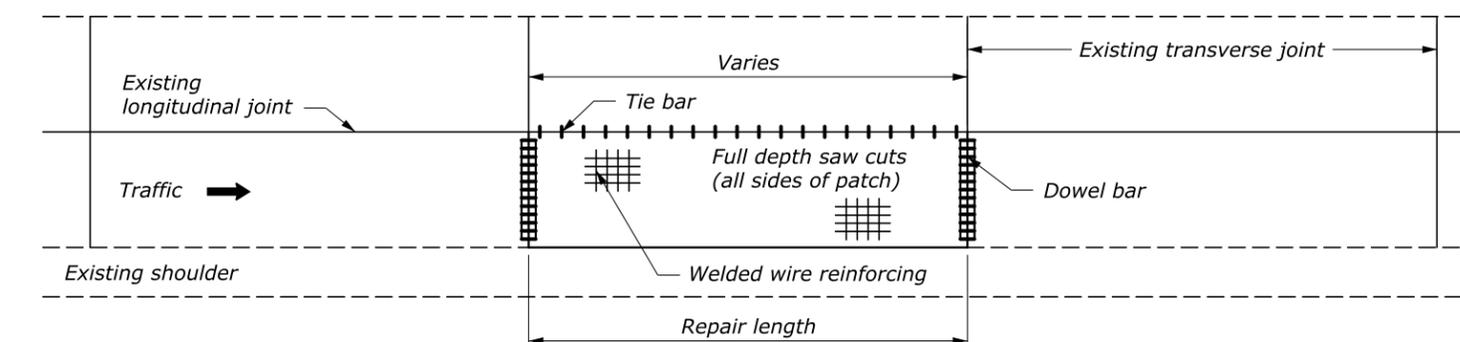

METHOD D

FULL DEPTH PATCHING LAYOUTS

NO SCALE

U.S. DEPARTMENT OF TRANSPORTATION FEDERAL HIGHWAY ADMINISTRATION EASTERN FEDERAL LANDS HIGHWAY DIVISION	
U.S. CUSTOMARY DETAIL	
CONCRETE PAVEMENT RESTORATION	
REVISOR: 8/2016 4/2020	DETAIL ET 502-1