NOTE:

reinforcing.

and information.


replacement plan for approval.

1. See Standard 501-1 for full depth patching welded wire

2. See Standard 501-2 for full depth patching joint details


3. If reinforcement is present within the partial-depth patch area and the bond is destroyed, remove adjacent concrete an additional 3/4 inch. If reinforcement is damaged, remove and replace in kind. Submit reinforcement


PLAIN CONCRETE PAVEMENT

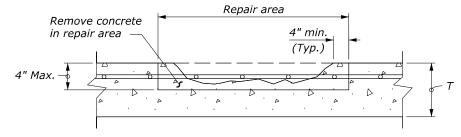



REINFORCED CONCRETE PAVEMENT

PARTIAL-DEPTH PATCHING

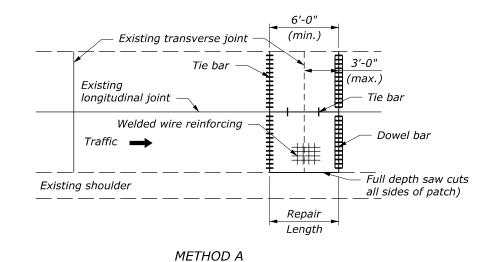

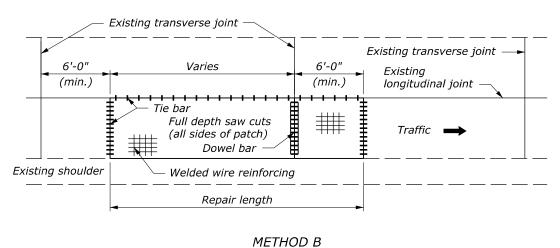

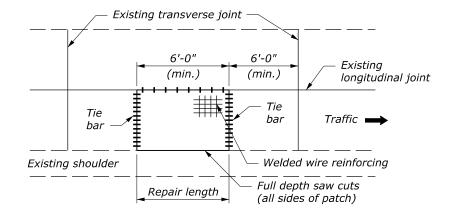

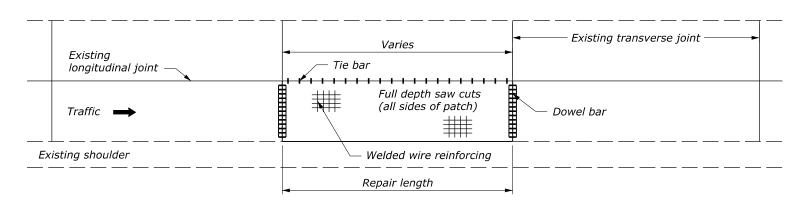

METHOD C METHOD D

FULL DEPTH PATCHING LAYOUTS

U.S. DEPARTMENT OF TRANSPORTATION FEDERAL HIGHWAY ADMINISTRATION
OFFICE OF FEDERAL LANDS HIGHWAY

FLH STANDARD

CONCRETE PAVEMENT RESTORATION

STANDARD APPROVED FOR USE --/---NO SCALE REVISED: 8/2016

STANDARD 502-1